

AC Current Probe Model JM810A

User Manual


DESCRIPTION


The JM810A (Catalog #2110.80) is designed for use in industrial environments. The "squared" jaws permit multiple conductor or bus bar positioning. The current output makes it the perfect tool for measurement with DMMs, recorders, and power and harmonic meters. The Model JM810A is compatible with any AC ammeter, multimeter, or other current measuring instrument with an input impedance lower than 1 Ω . To achieve the stated accuracy, use the JM810A with the DMM having an accuracy of 0.75 %.


WARNING

- These safety warnings are provided to ensure the safety of personnel and proper operation of the instrument.
- Read the instruction manual completely and follow all the safety information before attempting to use or service this instrument.
- Use caution on any circuit: high voltages and currents may be present and may pose a shock hazard.
- Read the Safety Specifications section prior to using the current probe. Never exceed the maximum voltage ratings given.
- Safety is the responsibility of the operator.
- ALWAYS connect the current probe to the display device before clamping the probe onto the sample being tested.
- ALWAYS inspect the instrument, probe, probe cable, and output terminals prior to use. Replace any defective parts immediately.
- NEVER use the current probe on electrical conductors rated above 600 V in overvoltage CAT III. Use extreme caution when clamping around bare conductors or bus bars.

INTERNATIONAL ELECTRICAL SYMBOLS

 This symbol signifies that the current probe is protected by double or reinforced insulation. Use only factory-specified replacement parts when servicing the instrument.

 This symbol signifies CAUTION! and requests that the user refer to the user manual before using the instrument.

 This symbol signifies that this is a type A current sensor and that application near and removal from HAZARDOUS LIVE conductors is permitted.

DEFINITION OF MEASUREMENT CATEGORIES

CAT IV: For measurements performed at the primary electrical supply (<1000 V), such as primary overcurrent protection devices, ripple control units, or meters.


CAT III: For measurements performed in the building installation at the distribution level, such as hardwired equipment in fixed installation or circuit breakers.

CAT II: For measurements performed on circuits directly connected to the electrical distribution system, such as household appliances or portable tools.

RECEIVING YOUR SHIPMENT

Upon receiving your shipment, make sure that the contents are consistent with the packing list. Notify your distributor of any missing items. If the equipment appears to be damaged, file a claim immediately with the carrier and notify your distributor at once with a detailed description of any damage.

CURRENT PROBE - JM810A DRAWING

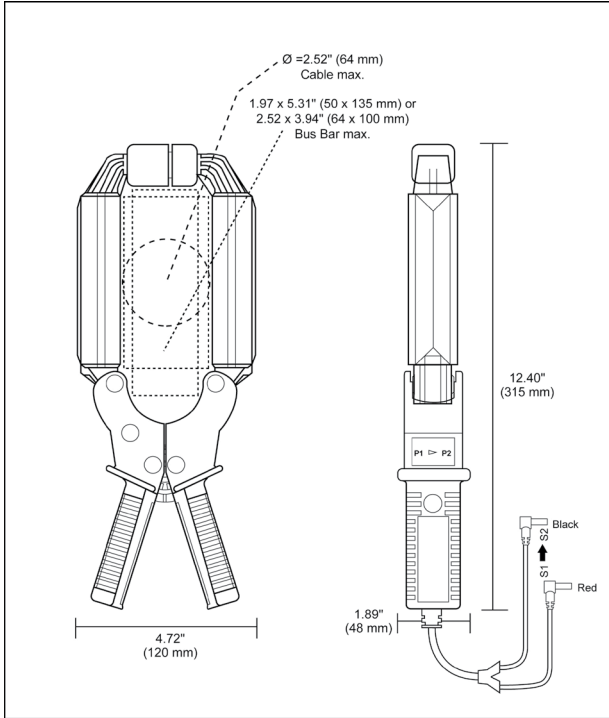

ELECTRICAL SPECIFICATIONS

Current Range:

(1 to 2000) AAC, continuous cycle for the full temperature range

Transformation Ratio:

2000:2

Output Signal:

1 mAAC / AAC (2 A at 2000 A)

Accuracy and Phase Shift*:

Primary Current	100 A	400 A	2000 A
Accuracy %	2 %	1 %	0.5 %
Phase shift	1.5°	0.75°	0.5°

*(Reference conditions: 23 °C ± 3 °C, (20 to 85) % RH, (48 to 65) Hz, external magnetic field <40 A/m, no DC component, no external current carrying conductor, test sample centered.)

Load impedance 0.5 Ω.

Overload: 2400 A for 10 min

Accuracy: Per IEC 185-26-27
Class 0.5 from (48 to 1000) Hz

Frequency Range:

30 Hz to 5 kHz; current derating above 1 kHz for continuous use.

Load Impedance: ≤ 1 Ω

Working Voltage: 600 VAC

Common Mode Voltage: 600 VAC

Influence of Adjacent Conductor:
0.005 A / AAC

Influence of Conductor in Jaw Opening:

1 % ± 0.1 A of reading

MECHANICAL SPECIFICATIONS

Operating Temperature:
(14 to 122) °F (-10 to 50) °C

Storage Temperature:
(-13 to 176) °F (-25 to 80) °C

Influence of Temperature:
<0.1 % per 10 °K

Jaw Opening: 3.54 in (90 mm)

Maximum Conductor Size:
Cable: 2.52 in Ø max. (64 mm)
Bus bar: 1.97 x 5.31 in (50 x 135 mm)
2.52 x 3.94 in (64 x 100 mm)

Envelope Protection:
IP 20 (IEC 529)

Drop Test:
500 mm (IEC 68-2-32)

Mechanical Shock:
100 g (IEC 68-2-27)

Vibration:
10/55/10 Hz, 0.15 mm (IEC 68-2-6)

Polycarbonate Material:
Handles: 10 % fiberglass charged polycarbonate UL 94 V0
Jaws: ABS UL 94 V2

Dimensions:
4.72 x 12.40 x 1.89 in (120 x 315 x 48 mm)

Weight:
2.65 lbs (1200 g)

Colors:
Dark gray handles with red jaws

Output:
5 ft (1.5 m) lead with safety 4 mm banana plug

SAFETY SPECIFICATIONS



Electrical:
Double insulation or reinforced insulation between primary or secondary and outer case of handle upon IEC 1010-2-32

Common Mode Voltage:
600 V CAT III, Pollution: 2

ORDERING INFORMATION

Current Probe JM810A..... Cat. #2110.80

Accessories
Banana plug adapter
(to non-recessed plug)..... **Cat. #1017.45**

OPERATION

Please make sure that you have already read and fully understand the WARNING section on page 1.

Making Measurements with the AC Current Probe Model JM810A

- Connect the black and red terminals to the Ampere AC range of your DMM or current measuring instrument. Select the appropriate current range (2 AAC). Clamp the probe around the conductor to be tested. If the reading is less than 200 mA, select the lower range until you obtain the best resolution. Read the value display on the DMM and multiply it by the probe ratio (1000/1). (If the reading = 0.592 AAC, the current flowing through the probe is 0.592 A x 1000 = 592 AAC).
- For best accuracy: carefully center the conductor inside the probe jaw, avoid if possible, the proximity of other conductors which may create noise.

Tips for Making Precise Measurements

- When using a current probe with a meter, it is important to select the range that provides the best resolution. Failure to do this may result in measurement errors.
- Make sure that probe jaw mating surfaces are free of dust and contamination. Contaminants cause air gaps between the jaws, increasing the phase shift between primary and secondary. It is very critical for power measurement.

MAINTENANCE



Warning

- For maintenance use only original factory replacement parts.
- To avoid electrical shock, do not attempt to perform any servicing unless you are qualified to do so.
- To avoid electrical shock and/or damage to the instrument, do not get water or other foreign agents into the probe.

Cleaning

To ensure optimum performance, it is important to keep the probe jaw mating surfaces clean at all times. Failure to do so may result in error in readings. To clean the probe jaws, use very fine sand paper (fine 600) to avoid scratching the jaw. Then, gently clean the jaws with a soft oiled cloth.

REPAIR AND CALIBRATION

You must contact our Service Center for a Customer Service Authorization number (CSA#). This will ensure that when your instrument arrives, it will be tracked and processed promptly. Please write the CSA# on the outside of the shipping container.

Chauvin Arnoux®, Inc. d.b.a. AEMC® Instruments
15 Faraday Drive
Dover, NH 03820 USA
Phone: (800) 945-2362 (Ext. 360)
(603) 749-6434 (Ext. 360)
Fax: (603) 742-2346 or (603) 749-6309
E-mail: repair@aemc.com

(Or contact your authorized distributor)

NOTE: All customers must obtain a CSA# before returning any instrument.

TECHNICAL AND SALES ASSISTANCE

If you are experiencing any technical problems, or require any assistance with the proper use or application of this instrument, please contact our technical hotline:

Chauvin Arnoux®, Inc. d.b.a. AEMC® Instruments
15 Faraday Drive
Dover, NH 03820 USA
Phone: (800) 343-1391 (Ext. 351)
Fax: (603) 742-2346
E-mail: techsupport@aemc.com

LIMITED WARRANTY

The current probe is warranted to the owner for a period of two years from the date of original purchase against defects in manufacture. This limited warranty is given by AEMC® Instruments, not by the distributor from whom it was purchased. This warranty is void if the unit has been tampered with, abused, or if the defect is related to service not performed by AEMC® Instruments.

Full warranty coverage and product registration is available on our website at:
www.aemc.com/warranty.html.

Please print the online Warranty Coverage Information for your records.