


# Clamp-On Ground Resistance Testers Models 3710 and 3730

## USER MANUAL

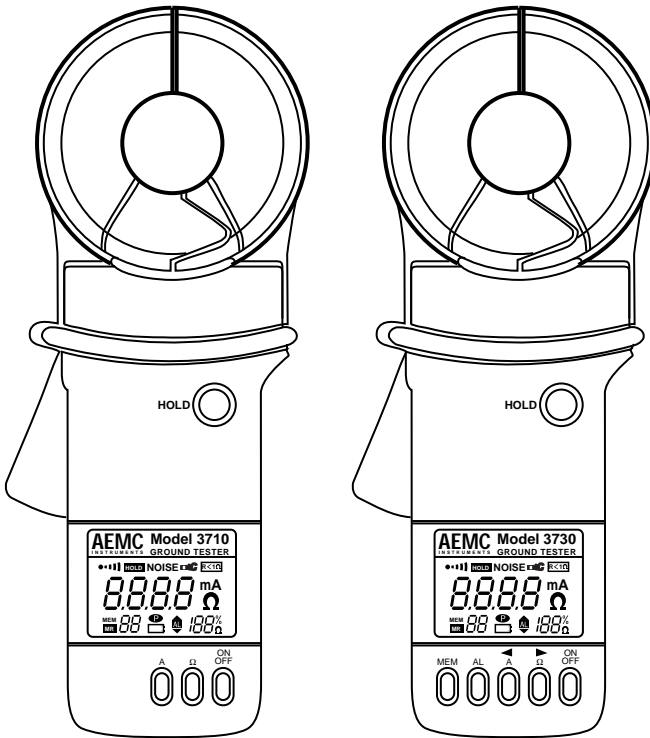

## Owner's Record

The serial number for the Model 3710 or Model 3730 is located inside the battery compartment of the instrument. Please record this number and purchase date for your records.

CLAMP-ON GROUND RESISTANCE TESTER MODEL 3710

CATALOG #1221.01

SERIAL #: \_\_\_\_\_

PURCHASE DATE: \_\_\_\_\_

DISTRIBUTOR: \_\_\_\_\_

CLAMP-ON GROUND RESISTANCE TESTER MODEL 3730

CATALOG #1221.02

SERIAL #: \_\_\_\_\_

PURCHASE DATE: \_\_\_\_\_

DISTRIBUTOR: \_\_\_\_\_

## Table of Contents

Warning .....	3
Receiving Your Shipment .....	4
Packaging .....	4
Government Orders .....	4
Description .....	5
Electrical Specifications .....	7
Mechanical Specifications .....	7
Safety Specifications .....	8
Model 3710 Controls .....	9
Model 3730 Controls .....	10
Digital Display Features .....	11
Additional Features of the Model 3730 .....	12
Function Controls .....	13
Programming the Alarm Setpoint .....	17
Changing the Alarm Trigger .....	18
Memory .....	19
Memory Recall .....	19
Clear Memory .....	19
Function Access Summary .....	20
Programming Summary .....	20
Principle of Operation .....	21
Field Applications .....	23
Operating Reference Card .....	31
Calibration Check Loop .....	32
Commonly Asked Questions .....	33
Battery Replacement .....	34

**Table of Contents (cont.)**

Troubleshooting . . . . .35  
Repair and Calibration . . . . .36  
Technical and Sales Assistance . . . . .36  
Limited Warranty . . . . .Inside back cover

## Warning

These safety warnings are provided to ensure the safety of personnel and the proper operation of the instrument.

- The instrument must not be operated beyond its specified operating range.
- Safety is the responsibility of the operator.
- All metal objects or wires connected to the electrical system should be assumed to be lethal until tested. Grounding systems are no exception.
- Use extreme caution when using the instrument around energized electrical equipment.
- Never attempt to use the instrument to twist or pry the ground electrode or ground wire away from the equipment being grounded.
- Open and close the clamp-on jaws slowly ensuring proper alignment.
- AEMC® Instruments considers the use of rubber gloves to be an excellent safety practice even if the equipment is properly operated and correctly grounded.

## Receiving Your Shipment

Upon receiving your shipment, be sure that the contents are consistent with the packing list. Notify your distributor of any missing items. If the equipment appears to be damaged, file a claim immediately with the carrier and notify your distributor at once, giving a detailed description of any damage. Save the damaged packing container to substantiate your claim.

## Packaging

The Clamp-On Ground Resistance Testers Model 3710 (Cat. #1221.01) and Model 3730 (Cat. #1221.02) are shipped with a hard carrying case, one 9 V battery (not installed), an instruction manual with warranty registration and a calibration loop. The manual, warranty card, and calibration loop are located behind the “egg crate” foam on the inside of the carrying case cover.

## Government Orders

The Clamp-On Ground Resistance Tester Model 3710 (Cat. #1221.01) has been issued a National Stock Number. Orders for the Model 3710 should reference NSN 6625-01-377-8030.

## Accessories

One multiple calibration loop, Cat. #1223.01

## Description

### Outline

The ground resistance tester Models 3710 and 3730 measure ground rod and small grid resistance through any season, without the use of auxiliary ground rods. Clamp-on ground resistance testers are used in multi-grounded systems without disconnecting the ground under test. The Models 3710 and 3730 simply clamp around the ground conductor or rod and measure the resistance to ground. By performing measurements on intact ground systems, the user also verifies the quality of the grounding connections and bonds. Resistance and continuity of grounding loops around pads and buildings may also be measured.

Both models include a current measurement function. The probe's high sensitivity enables measurement of leakage current flowing to ground or circulating in ground loops down to 1 mA and neutral currents to 30 A rms. This feature provides additional information which is becoming vital as distribution ground networks carry higher levels of noise and harmonics which affect power quality.

Both models offer battery life information at power-up and Auto-Off for power management. Additional features are also displayed on the large LCD to ensure precise measurements. The Buzzer and Auto-Off features may be disabled from the push-buttons at any time.

The Model 3730 offers an Alarm function and a Memory (logging) function. In the Alarm mode, the probe will audibly and visually indicate if the reading is beyond an input set point. The user may also have the Alarm initiated above or below the set point. This Alarm feature permits quick field checks where only "pass" or "fail" readings will suffice.

The Memory function logs up to 99 measurements (Ohms or Amperes). This enables the user to conduct field surveys, and to retrieve and analyze the readings at a later time. The alarm settings and stored memory information are saved when the ground tester is turned off.

### Product Construction

The Models 3710 and 3730 body cases are built of Lexan® for rugged use. The probe heads are encapsulated in a double-walled Lexan® shell

for extra strength and are reinforced at the body interfaces for enhanced field reliability. Overall construction and mechanical design ratings such as drop test, shock and vibration, weatherproofing against water projections or dust, meet or exceed IEC (International Electrotechnical Commission) standards. The products have also been designed to meet IEC 1010, UL 1244, CSA and GS safety approvals .

### **Jaw Design**

The probe head, or jaw, is a key component in the measurement and overall product performance. Considerable research and development were dedicated to ensuring its performance, reliability and versatility.

The large jaw has an inner opening diameter of 1.25" (32 mm) - double its predecessor's diameter - while retaining the same overall jaw thickness, permitting use on tight ground conductors on poles and in manholes. The large opening accommodates not only ground rods, but larger ground conductors (up to 1000 MCM) typically found in telecommunication or railroad applications.

The inner jaw is composed of two independent and individually shielded magnetic cores permitting the injection of a test signal and accurate return signal measurement without noise interference or cross talk common to separate probe instruments.

Thorough mechanical design, including small winglets, ensures repetitive jaw alignment for accuracy and prevents undesirable insertions into the jaw spring assembly.

### **Body Design**

The ergonomic body design permits one-handed operation. The guard provides additional strength, and prevents the hand from slipping or coming into contact with conductors under test. The Lexan® body construction provides strength. The LCD lens cover may be easily replaced if scratched. The sealed push-buttons directly access all test functions and are easily operated even with gloved hands.

Lexan® is a registered trademark of General Electric Corporation.



## Electrical Specifications

Ground Resistance			
Measurement Range	Range	Resolution	Accuracy*
Autoranging 1.0 to 1200 Ω	1.0 to 50.0 Ω	0.1 Ω	± (1.5% + 0.1 Ω)
	50.0 to 100.0 Ω	0.5 Ω	± (2.0% + 0.5 Ω)
	100 to 200 Ω	1 Ω	± (3.0% + 1 Ω)
	200 to 400 Ω	5 Ω	± (6.0% + 5 Ω)
	400 to 600 Ω	10 Ω	± (10% + 10 Ω)
	600 to 1200 Ω	50 Ω	Approx. 25%
Ground or Leakage Current			
Autoranging	1 to 300 mA	1 mA	± (2.5% + 2 mA)
1 mA to 30.00 A rms	0.300 A to 3.000 A	0.001 A	± (2.5% + 2 mA)
	3.00 A to 30.00 A	0.01 A	± (2.5% + 20 mA)

\* Reference conditions: 23°C ± 3K, 50% RH ± 10%, battery at 8 V ± 0.2V, external magnetic field < 40 A/m, external electrical field < 1 V/m, conductor centered, loop resistance noninductive. Accuracy % of reading.

**Resistance Measurement Frequency:** 1689 Hz

**Resistance Overload:** OL displayed above 1200 Ω

**Current Measurement Frequency:** 47 to 800 Hz

**Current Overload:** OL displayed above 30 A rms

### MECHANICAL SPECIFICATIONS

**Dimensions:** 9.25 x 3.94 x 2.17" (235 x 100 x 55 mm)

**Weight:** 2.2 lbs. (1 kg)

**Case Material:** Lexan® 920A (UL94V2)

**Jaw Cover Material:**

Lexan® 500R with 10% fiberglass charge (UL94V0)

**LCD Cover Material:** Lexan® 920A (UL94V1)

**Color:** Gray body, red jaws

**Jaw Window Diameter:** 1.25" (32 mm)

**Jaw Opening:** 1.38" (35 mm)

**Operating Temperature:** -10 ° to 55 °C

**Operating Humidity:** 0 to 90% RH @ -10 ° to 40 °C, 75% RH @ 55 °C

**Storage Temperature:** -40 ° to 70 °C

**Power Supply:** 9 V alkaline (IEC 6LF22 or NEDA 1604A)

**Battery Life:**

typical: 8 hours or approximately 1000 measurements of 30 seconds

**LCD:** 3-3/4 digit, 1.73 x 1.10" (44 x 28 mm)

**US Design Patent:** #362,639

**SAFETY SPECIFICATIONS**

*UL, CSA approvals pending*

*IEC 1010-1 Double Insulation*

**Environmental:** IP30, IEC 359 Group III

**Vibration Test:** IEC 68-2-6

**Shock Test:** IEC 68-2-27

**Drop Test (1m):** IEC 68-2-32

**Dielectric Test:** 2500 V AC

**Working Voltage:** 150 V, Cat. III - Pollution Degree 2


300 V, Cat. III - Pollution Degree 1

**Max A Overload:** 100 A continuous, 200 A (< 5s) 50/60 Hz

OL displayed above 30 A rms

**Calibration Cycle:** Calibration once a year is recommended

## Model 3710 Controls

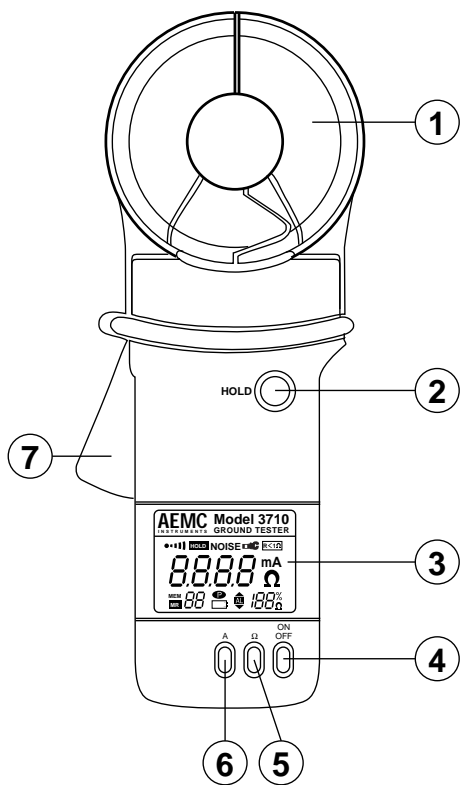

1. Head Assembly: Consists of two individually shielded magnetic cores
2. Hold: Freezes last measured value on the display
3. Display: 3000 count LCD, function indicators
4. ON/OFF: Power ON or OFF, activates display self-test at power-up
5.  $\Omega$ : Resistance measurement
6. A: Current measurement
7. Lever: Opens or closes jaws

## Model 3730 Controls

1. Head Assembly: Consists of two individually shielded magnetic cores
2. Hold: Freezes last measured value on the display
3. Display: 3000 count LCD, function indicators
4. ON/OFF: Power ON or OFF, activates display self test at power-up
5.  $\Omega$ : Resistance Measurement

▶ Increment the Alarm setpoint, increment Memory position in program mode


6. A: Current Measurement

◀ Decrement the Alarm setpoint, decrement the Memory in program mode

7. Lever: Opens or closes jaws

8. AL: Activates/deactivates the Alarm function, access the value of the Alarm setpoint in program mode

9. MEM: Stores the reading into memory, reads Memory Recall (MR) values and clears the memory in recall mode

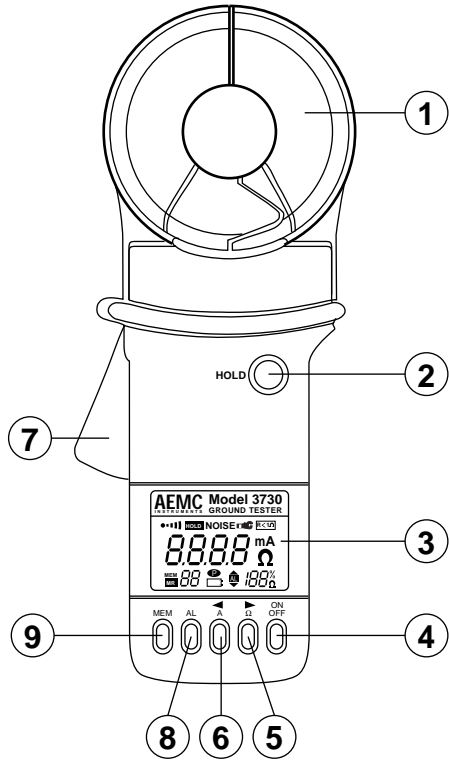

## Digital Display Features





 


Figure 3

-  Displayed when the beeper is active. To turn the beeper On/Off, push ON & Ω together at power-up. The beeper is active when displayed.
-  Displayed when the HOLD function is activated. This function locks the present displayed value. During HOLD: A, Ω, and Alarm functions are deactivated. The Memory function may still be used.
-  Indicates that the jaws of the instrument are not properly closed. The Open Jaw indication is present only in the Ω Mode. Check for foreign matter in the jaw mating surface.
- NOISE** In the Ω function, this symbol indicates the presence of excessive stray noise in the ground electrode under test. This symbol will be present if noise signals reach an amplitude of approx. 5 A or 50 V. Resistance measurement values are no longer valid. The beeper is also activated.
-  Displayed when measured resistance is below 1 Ω. This may indicate that grounding electrode you are clamped onto is continuous with itself (the instrument is measuring a metallic loop and not the ground electrode resistance). In this situation, electrode resistance measurements may not be valid.
- mA, A** Current measurement mode.
- Ω** Ground resistance measurement mode.

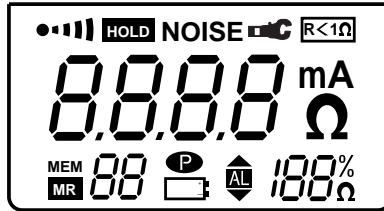

Indicates the Auto-Off feature is deactivated and the instrument stays on permanently (until turned off by the user). With no symbol displayed, after 5 minutes of non-use the instrument will automatically shut itself off. The Auto-Off feature is turned On/Off by pressing Hold at power-up.



Display flashes this symbol (1/second) during a low battery condition. Measurements are still possible. When this symbol is displayed continuously, measurements are no longer possible. Battery replacement is necessary.



Indicates the approximate percentage of useful battery life remaining (0-100%). This function is displayed only upon initial power-up when the ON push-button is held down for more than 3 seconds.



The overload symbol will illuminate when the measurement reading is beyond the limits of the instrument:

Resistance > 1200Ω

Current > 30.00 A rms

The beeper is activated in current overload.

### Additional Features of the Model 3730



Indicates that an alarm set point is set in memory. Alarm set points may be set from 1 to 199Ω.

Arrows indicate whether the measured value is above or below alarm setpoint.



Memory function is activated. Ninety-nine (99) separate values may be logged for either resistance (Ω), current (A) or a combination thereof. At the 99th value, display number will blink indicating that memory is full.



Memory recall register. Displays the numbered value being recalled from memory (1-99).

**Note:** Models 3710 and 3730 share the same LCD and display all segments at power-up. Functions not available on the 3710 are displayed at power-up.

## Function Controls

Model 3710 and 3730 share common functions (On/Off, A,  $\Omega$ , Auto-off, Buzzer disable, Hold). Even though the Model 3710 is shown in the examples for these functions, the controls will respond identically for the Model 3730.

### On/Off

The ON/OFF push-button, when pushed actuates power on or power off with an audible control tone. Upon initial power-up, the instrument will be in the Ohms function ( $\Omega$ ) and will go to OL until clamped on. When the ON push-button is pushed and held down, after three seconds the instrument will beep and provide a self test featuring a full function display (Fig. 4) followed by status indications for:

- Status of remaining battery life (battery symbol blinks, 0-100%) (Fig. 5)
- Number of stored values in memory (MEM blinks, 0-99) (Model 3730 only)

Release the ON/OFF push-button to initialize the instrument.

A light chirping sound may be heard in the  $\Omega$  mode. This is a normal condition generated by the instruments power management system.

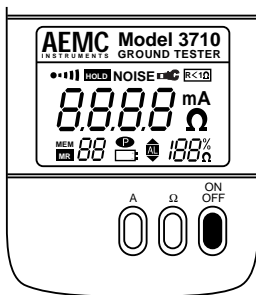


Figure 4

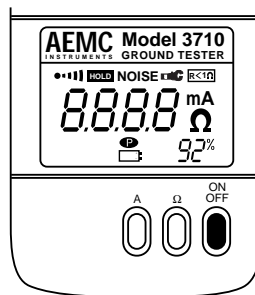


Figure 5

## Auto-Off

The instrument will shut off automatically after five minutes of non-use. The instrument will issue a short beep 15 seconds prior to shutting down and the LCD flashes once per second. The Auto-Off may be disabled by turning on the meter while holding down the HOLD push-button. The **P** indicator will appear on the display to indicate the Auto-Off feature has been disabled. (Fig. 6)

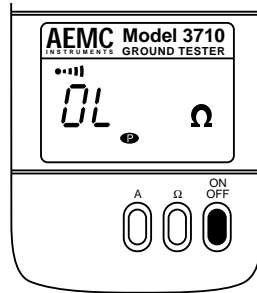


Figure 6

## Hold

The HOLD push-button freezes the last measured value onto the display. When the HOLD function is enabled, **HOLD** is displayed on the LCD. (Fig. 7)

When the HOLD function is enabled, other control functions are disabled (except the memory function).

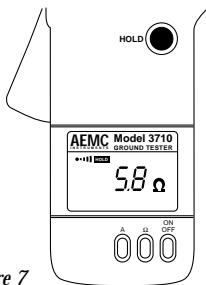


Figure 7

To exit HOLD, press the HOLD push-button and normal operation is resumed.

**Note:** When HOLD is pressed during power-up, the auto-off feature is disabled and **P** is displayed on the LCD. See Auto-Off.

## Beeper Disable

To disable the beeper, press the ON and  $\Omega$  together at power-up. The **•••||** indicator will disappear from the LCD. (Fig. 8)

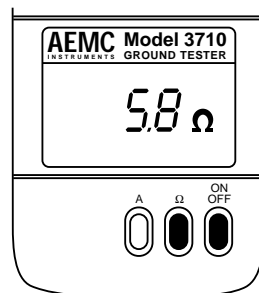


Figure 8



## Resistance

The  $\Omega$  function provides resistance measurements from 1.0 to 1200 $\Omega$  in six autoranges. (Fig. 9)

Range	Resolution
1.0 to 50.0 $\Omega$	0.1 $\Omega$
50.0 to 100.0 $\Omega$	0.5 $\Omega$
100 to 200 $\Omega$	1 $\Omega$
200 to 400 $\Omega$	5 $\Omega$
400 to 600 $\Omega$	10 $\Omega$
600 to 1200 $\Omega$	50 $\Omega$

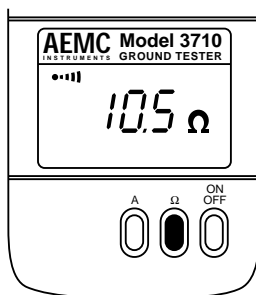


Figure 9

Upon initial power-on, the  $\Omega$  function is chosen by default.

The Models 3710 and 3730 will track down to 0.7  $\Omega$  and indicate  $R < 1 \Omega$  below 1  $\Omega$  (Fig. 10). Below 0.7  $\Omega$  the display stays locked on 0.7  $\Omega$ . Accuracy is not defined below 1  $\Omega$ . Measurements below 1  $\Omega$  typically indicate the ground tester is clamped onto a closed loop and that the signal is not flowing through the ground under test.

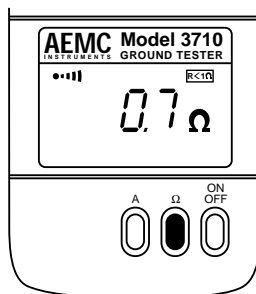


Figure 10

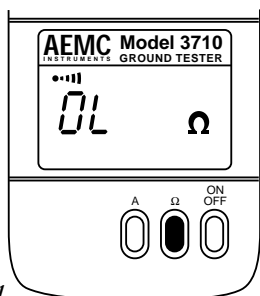


Figure 11

If the resistance readings are above 1200  $\Omega$ , OL will be displayed on the LCD (Fig. 11). This may indicate high ground resistance but may also be caused by a disconnected or poorly bonded ground.

## Current

Press A to enter the current function. True RMS current measurements are possible up to 30.00 A.(Fig. 12)

Above 30 Arms, OL will be displayed and the test must be discontinued. The beeper is also activated during OL.

Range	Resolution
1 to 300 mA	1 mA
0.300 to 3.000 A	0.001 A (1 mA)
3.00 A to 30.00 A	0.01 A (10 mA)

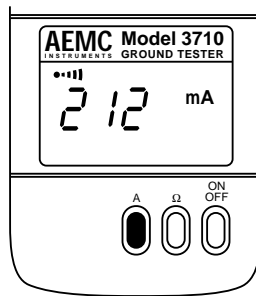


Figure 12

## Alarm

Turn the Alarm on/off by pressing the AL button. The alarm feature provides a continuous audible warning (when beeper is active) and visual indications when a setpoint has been reached (Fig. 13, 14) (e.g. alarm indication when ground electrode resistance is above the NEC limit of 25  $\Omega$ .) If the alarm is not triggered, only **AL** will be displayed indicating that the alarm is active.

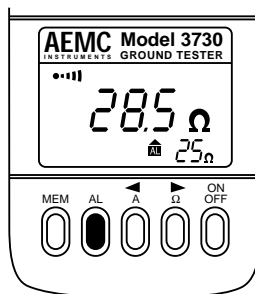


Figure 13

## Programming the Alarm Setpoint

To program the alarm setpoint, push ON and AL together at power-up. The alarm setpoint value will blink. To program the proper setpoint value (1 to 199  $\Omega$ ), use the cursor arrows (  $\blacktriangleleft$  down,  $\blacktriangleright$  up).

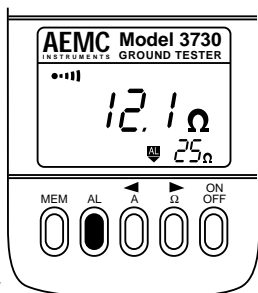


Figure 14

When the setpoint is reached, turn the instrument off. This will put the setpoint into memory. Turn the instrument back on (you may need to press AL to activate the alarm feature).

**Note:** The alarm setpoint is preset at 25  $\Omega$ . The alarm will be triggered when the setpoint is *exceeded*.

The user has the option of having the alarm triggered when a reading is *below* the programmed setpoint. This is accomplished with an internal switch and outlined in the following section.

## Changing the Alarm Trigger

The Model 3730 alarm may be set to trigger above or below a setpoint. Follow the procedure below for setting the alarm trigger.

1. The instrument must be OFF and disconnected from any conductor.
2. Place the meter face down and remove the two phillips screws on the back of the instrument.
3. Remove the back cover by pulling down and away from the instrument.
4. To set the alarm to trigger above a setpoint, slide the alarm setpoint switch to the right. To set the alarm to trigger below a setpoint, slide the alarm setpoint switch to the left.
5. Replace the back cover while ensuring that it slips beneath the hold-down lip and fits securely into position. Use caution not to pinch the battery leads.
6. Install and tighten screws.

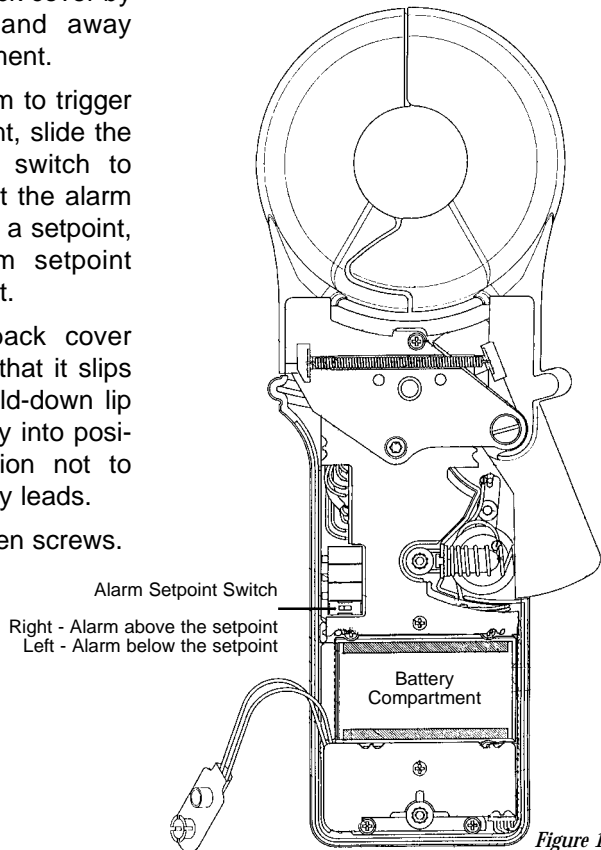


Figure 15

## Memory

To activate the Memory feature, press the A and ON buttons together at power-up (Fig. 16). MEM will be displayed.

The Memory feature allows the user to log into memory 1 to 99 measured values (including OL). Measured values can now be logged for both resistance ( $\Omega$ ) and amps (A) by pushing the MEM button during measurement and during "HOLD". A long beep indicates the measurement was stored. After the 99th value is entered (MEM 99) will blink indicating memory is now full. Measurements may still be made but no longer logged. Stored values are retained when the instrument is turned off.

Pressing the A and ON buttons again at power-up will de-activate the Memory feature.

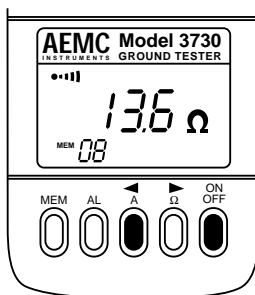


Figure 16

## Memory Recall

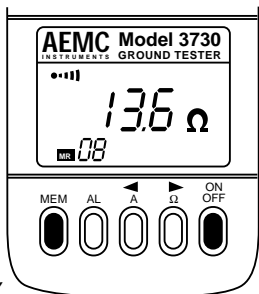


Figure 17

To recall memory values, push ON and MEM together at power-up. MR will be displayed with the memory number (Fig. 17). Memorized value will be displayed. To select stored values use the cursor arrows ( $\blacktriangleleft$  down,  $\blacktriangleright$  up). For rapid access of memory recall values, press the cursor push-button continuously.

Turn the instrument off to exit the Memory Recall mode.

## Clear Memory

To clear the memory, push ON & MEM together at power-up and hold them down. After a three second interval the "clear" message will be displayed (Fig. 18) along with four repetitive beeps and a fifth long tone. The memory is now cleared (Fig. 19).

Once cleared, releasing the ON & MEM buttons returns the instrument to Resistance measurement mode.

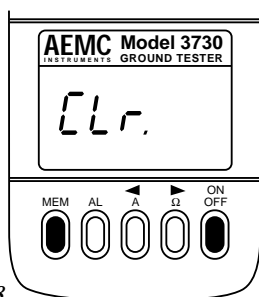


Figure 18

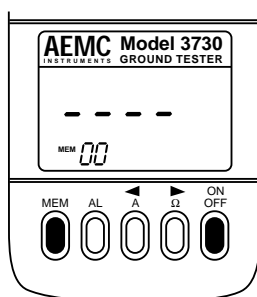


Figure 19

## Function Access Summary

Function	Push Button(s) Used	Function Setting Saved @ Power Down
On/Off	ON/OFF	
$\Omega$ Function	$\Omega$	Default Setting
A Function	A	No
Alarm Function ( $\Omega$ )	AL	Yes
Display Hold	HOLD	No
Auto-Off On/Off	ON + HOLD	No
Beeper On/Off	ON + $\Omega$	No (3710), Yes (3730)

## Programming Summary

Function	Push Buttons Used	Function Setting Saved @ Power Down
Memory On/Off	ON + A	Yes
Memory Recall (MR)	ON + MEM (< 2 sec)	No
Clear Memory	ON + MEM (> 6 sec)	No
Program Alarm Setpoint	ON + AL	No

## Principle of Operation

Typically grounded distribution system may be simulated by the basic circuit shown in Fig. 20 or an equivalent circuit, shown in Fig. 21. If voltage (V) is applied to any measured grounding electrode Rx through a special transformer, current (I) flows through the circuit, thereby establishing the following equation:

$$\frac{V}{I} = R_x + \frac{1}{\sum_{i=1}^n \frac{1}{R_i}} \quad \text{where, usually } R_x \gg \frac{1}{\sum_{i=1}^n \frac{1}{R_i}}$$

Therefore,  $V/I = R_x$  is established. If I is detected and measured with V kept constant, the measured grounding electrode resistance Rx can be obtained. A signal is fed to a special transformer via a power amplifier from a 1.689 kHz constant voltage oscillator. The resulting current is then sensed by a detection CT. An active filter is used to dampen earth current at commercial frequency and high-frequency noise.

Example: If we clamp around any grounding electrode in a multi-grounded system, the measured value of the electrode under test will be the resistance of that particular rod in series with the equivalent parallel resistance value that the rest of the multi-grounded system represents. If we had an electrical system that had 101 grounding electrodes and each had a resistance value of 25  $\Omega$ , and we were to clamp around any electrode in the system, the measured value would be 25  $\Omega$  in series with the equivalent parallel resistance or 0.25  $\Omega$ . The displayed value would be 25.2  $\Omega$  (instrument resolution to 0.1  $\Omega$ ).

$$\begin{aligned} V/I &= 25 \Omega + 0.25 \Omega \\ R_x &= 25.2 \Omega \end{aligned}$$

In most field applications, the number of electrodes that make up a multi-grounded system would be higher, therefore the equivalent parallel resistance is negligible with respect to the rod under test.

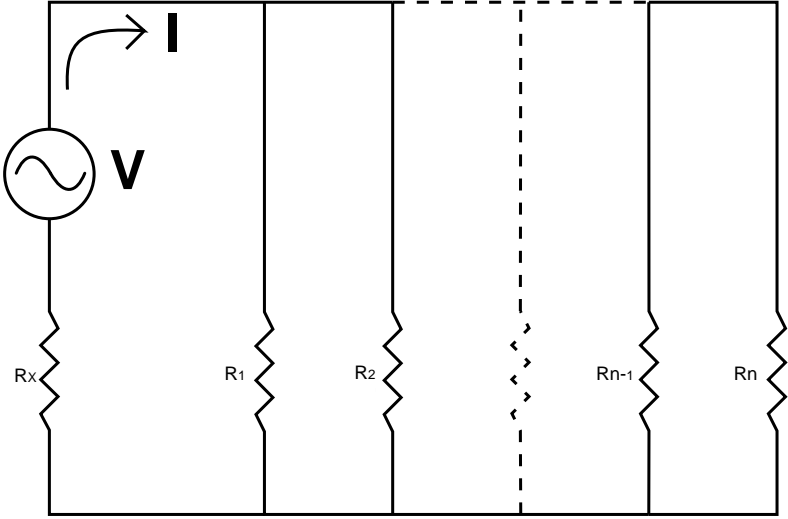


Figure 20

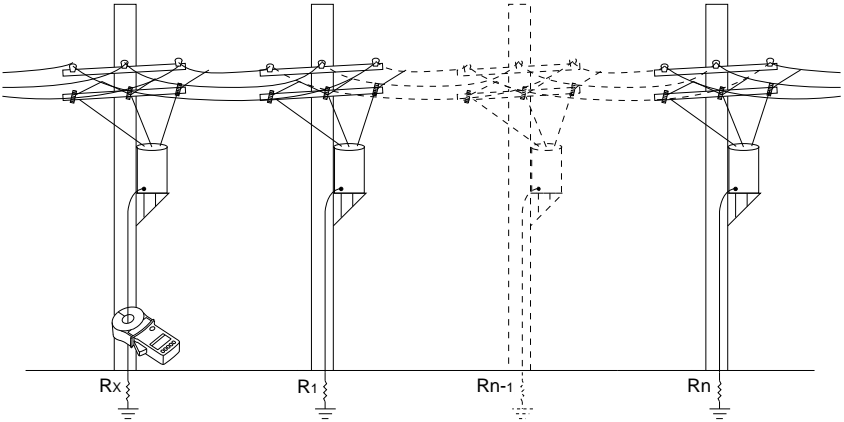


Figure 21



## Field Applications

### Pole Ground Rods

Remove any molding covering the ground conductor, and provide sufficient room for the jaws of the clamp-on. The jaws must be able to close easily around the conductor. The jaws can be placed around the ground rod itself.

**Note:** The instrument must be placed so that the jaws close around an electrical path from the system neutral or ground wire to the ground rod or rods as the circuit provides.

Select the current range “A.” Clamp onto the ground conductor and measure the ground current. The maximum range is 30.00 A Trms. However, if the ground current exceeds 5 A or noise exceeds 50 V, ground resistance measurements are not possible. *Do not proceed further with the measurement.* Remove the instrument from the circuit noting the location for maintenance and continue to the next test location.

After noting the ground current, select the ground resistance range ( $\Omega$ ) and measure the resistance directly. The reading you measure with the clamp-on tester indicates not just the resistance of the rod, but of the connection to the system neutral and all bonding connections between the neutral and the rod.

Note that in Fig. 22 there is both a butt plate and a ground rod. In this type of circuit, it is necessary to place the instrument above the bond so that both grounds are included in the test. For future reference, note the date, ohms reading, current reading and pole number. Replace any molding you may have removed from the conductor.

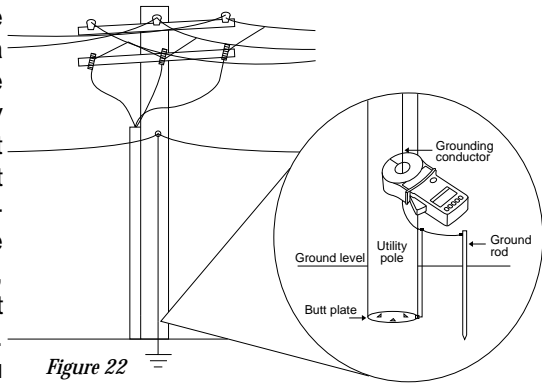


Figure 22

**Note:** A high reading or OL indicates one or more of the following:

- A. Poor ground rod
- B. Open ground conductor
- C. High resistance bonds on the rod or splices on the conductor;  
watch for buried split butts, clamps, and hammer-on connections.

### Service Entrance or Meter

Follow the same procedure as for Pole Ground Rods. Notice that Fig. 24 shows multiple ground rods and in Fig. 23 the ground rods have been replaced with a water pipe ground. You may also have both types acting as a ground. In these cases, it is necessary to make the measurements between the service neutral and both grounded points.

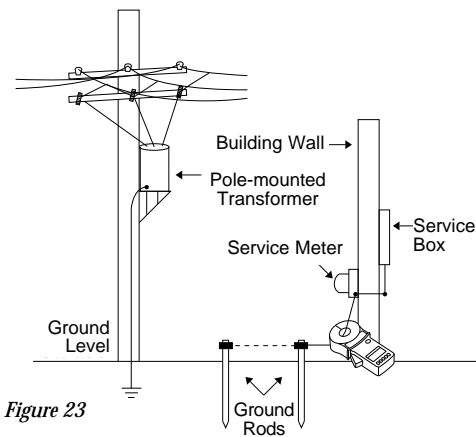


Figure 23


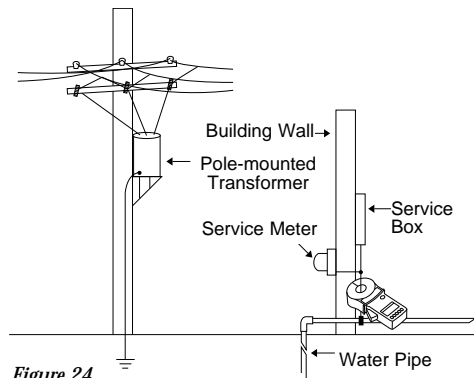


Figure 24

## Pad Mounted Transformer


*Observe all safety requirements — High voltage may be present!*

Locate and number all rods (usually only a single rod is present). If the ground rods are inside the enclosure, refer to Fig. 25 and if they are outside the enclosure, refer to Fig. 26. If a single rod is found within the enclosure, the measurement should be taken on the conductor just before the bond on the ground rod. Often, more than one ground conductor is tied to this clamp, looping back to the enclosure or neutral.

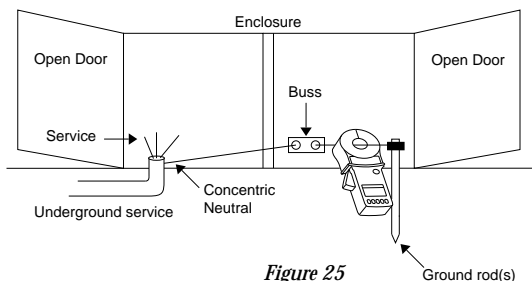

In many cases, the best reading can be obtained by clamping the instrument onto the ground rod itself, below the point when the ground conductors are attached to the rod, so that you are measuring the ground circuit. Care must be taken to find the conductor with only one return path to the neutral.

Generally  $0.7 \Omega$   $\boxed{R < 1\Omega}$  indicates that you are on a closed loop. In Fig. 26, the ground rod is located outside the enclosure. Clamp at the indicated measuring point to obtain the correct reading. If more than one rod exists at different corners of the enclosure, it is necessary to determine how they are connected to properly measure the ground resistance.

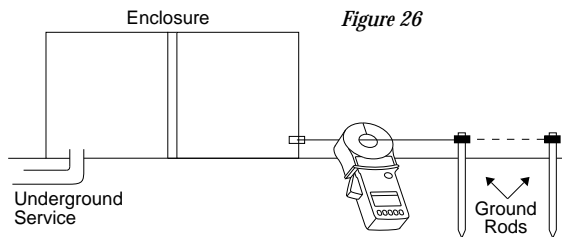

## Transmission Towers

*Observe all safety requirements — Dangerously high voltage may be present!*

Locate the ground conductor at the base of the tower. Many different configurations exist. Care should be taken when searching for the ground conductor. Fig. 27 shows a single leg mounted on a concrete pad with an external ground conductor. The point at which you clamp the instrument should be above all splices and connections which allow for multiple rods, butt wraps, or butt plates.

**Note:** Current flowing to ground may be high.

## Central Office Locations

The main ground conductor from a ground window or a ground plane is usually the location to clamp the tester. Due to the wiring practices within the central office, there are many locations at which you can look at the water pipe or counterpoise from within the building. An effective location is usually at the ground buss in the power room, or near the backup generator.

By measuring current and resistance at several points and comparing the readings, you will be able to identify neutral loops, utility grounds and central office grounds. The test is effective and accurate when the ground window is connected to the utility ground at only one point.

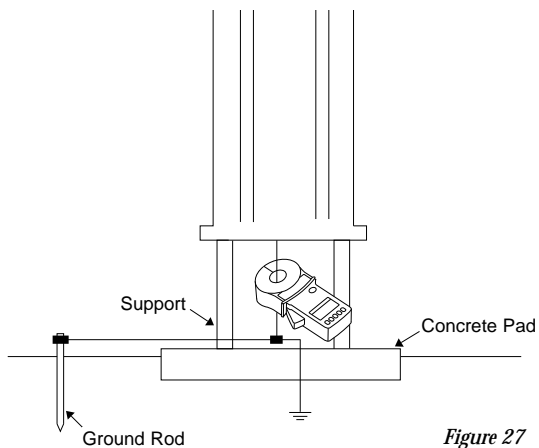


Figure 27

## Service Panel

If we clamp-on the grounding electrode conductor in Fig. 28, the multi-grounded system required to complete the circuit may be from different sources. These sources may include the following: Electric Neutral, Phone, CATV, and Water.

The Electric Utility Neutral should be the principle conductor of the low-impedance signal return path required to test the resistance of this ground electrode with the Model 3710/3730. This can be verified by removing other ground connections, noting if any changes appear in the readings. If by removing one of these signal return paths a much higher reading is noted, it could mean that the primary signal return path (the Electric Neutral) is defective or open.

**Note:** For safety reasons do not remove any ground source without first de-energizing the service panel.

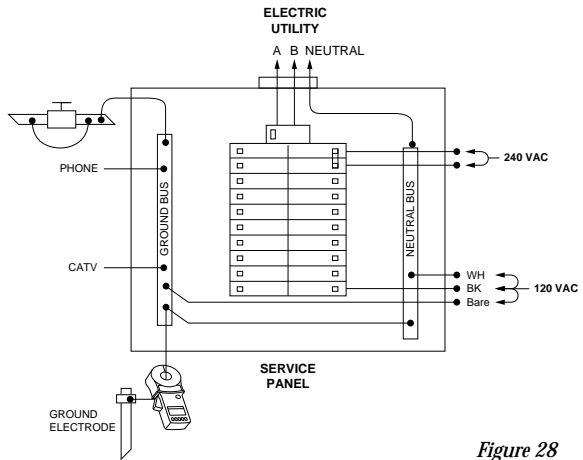


Figure 28

## Phone Pedestal

Provide sufficient room for the Model 3710/3730 jaws, which must be able to close easily around the conductor (Fig. 29). The jaws can be placed around the ground rod itself.

**Note:** If not enough room is available for this task refer to Fig. 30 and continue with this example. The clamp must be placed so that the jaws are in an electrical path from the sheath bond(s) or ground bar to the ground rod(s) as the circuit provides.

Select the current range “A.” Clamp onto the ground conductor and measure the ground current. The maximum current range is 30 Amps. If the ground current exceeds 5 Amps, ground resistance measurements are not possible. Do not proceed further with the measurement. Remove the clamp-on tester from the circuit, noting the location for maintenance, and continue to the next test location.

After noting the ground current, select the ground resistance range “ $\Omega$ ” and measure the resistance directly. The reading you measure with the 3710/3730 indicates the resistance of not just the rod, but also the connection to the sheath ground and all bonding connections between the sheath bond and the rod.

A high reading indicates one or more of the following:

- A. Poor ground rod
- B. Open ground conductor
- C. High resistance bonds on the rod or splices on the conductor. Also look for bad connections on the ground bar to the sheath(s).

**Note:** This same test can be done using the TIP instead of the sheath ground. However keep in mind that this is intended to be grounded only back at the central office.

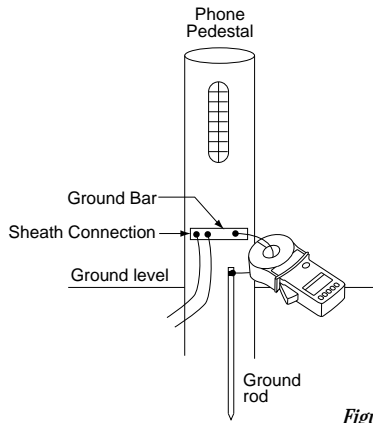


Figure 29

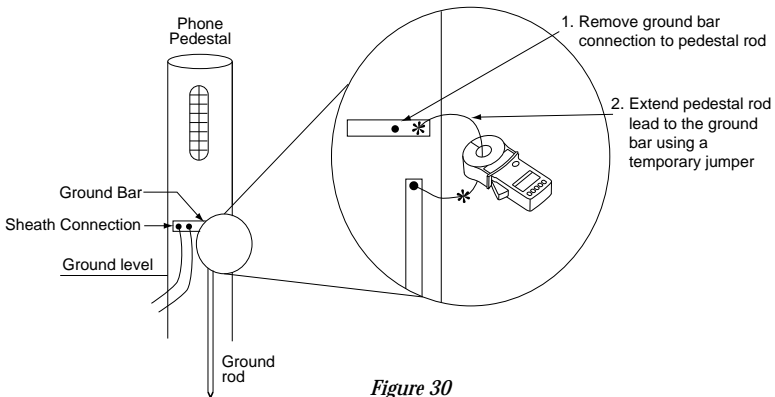


Figure 30

### Above Telephone Space

Select the current range "A." Clamp onto the ground wire and measure the current (Fig. 31). The maximum current range is 30 Amps. If the ground current exceeds 5 Amps, resistance measurements are not possible. Do not proceed further with the measurement. Remove the clamp-on tester from the circuit, noting the location for attention, and continue to the next test location.

After noting the current, select the ground resistance range “ $\Omega$ ” and measure the resistance directly. The reading you measure with the 3710/3730 indicates the bonding connections between the Telephone ground and the Power company ground. One of the following two scenarios should be observed:

- A. If “OL” or a high resistance reading is displayed this would indicate no bond has been established or a poor connection exists between the Telephone and Power grounds.
- B. If  $R < 1\Omega$  and/or a very low reading is displayed then the bond between these two grounds has been verified.

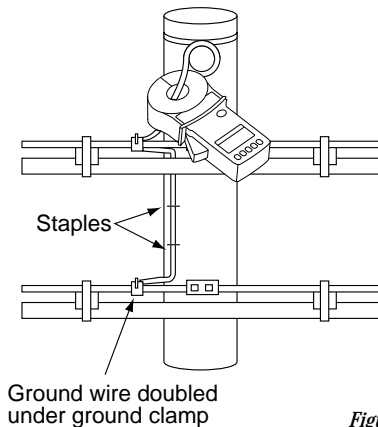


Figure 31

### General Measurement Notes

A reading of OL is most likely a cable which is not connected to the ground at both ends. It may be there is no ground rod at all, or that there is no path back to the system neutral.

A reading which is  $0.7\ \Omega$   $R < 1\Omega$  generally indicates that the cable where you are clamped is continuous with itself. You may have located a ground loop, which can usually be confirmed by comparatively high current readings also obtained when readings are taken at multiple locations. A good low resistance ground may also have very high AC current flowing, depending upon the type of equipment being grounded.



## Operating Reference Card

Included with the Model 3710 and 3730 you will find an operating reference card like the one shown here.

This card summarizes all the features of the Model 3710 and 3730.

**AEMC** Clamp-on Ground  
INSTRUMENTS Resistance Tester

---

### Model 3710/3730 Operating Reference

---

<input type="button" value="ON/OFF"/>	ON/OFF
<input type="button" value="Ω"/>	Measure ground resistance [Ω]
<input type="button" value="A"/>	Measure AC current [mA, A]
<input type="button" value="HOLD"/>	Freeze (hold) the display
<input type="button" value="Ω"/> + <input type="button" value="ON"/>	Toggle the buzzer [»] on/off
<input type="button" value="HOLD"/> + <input type="button" value="ON"/>	Toggle auto power on/off

---

### Model 3730 Additional Features

---

<input type="button" value="AL"/>	Turn alarm [AL] on/off
<input type="button" value="MEM"/>	Store the reading in memory
<input type="button" value="A"/> + <input type="button" value="ON"/>	Toggle memory display on/off
<input type="button" value="AL"/> + <input type="button" value="ON"/>	Program alarm mode. Use ◀▶ to adjust
<input type="button" value="MEM"/> + <input type="button" value="ON"/>	Short beep: On/off memory recall [MR]
<input type="button" value="MEM"/> + <input type="button" value="ON"/>	Long beep (6s): Clear memory [CLR]


◀ Down      Up ▶

Figure 32

## Calibration Check Loop

The multiple calibration loop is now replaced by a single point 25  $\Omega$  loop (Fig. 33). It is provided to perform a quick check of the instruments. Check the clamp-on ground resistance tester by clamping around the loop; the 3710 or 3730 should read between 24.2  $\Omega$  and 25.8  $\Omega$ .

\* Value is for ambient temperature between 68° and 78°F. Value may differ a few counts under or above this temperature.

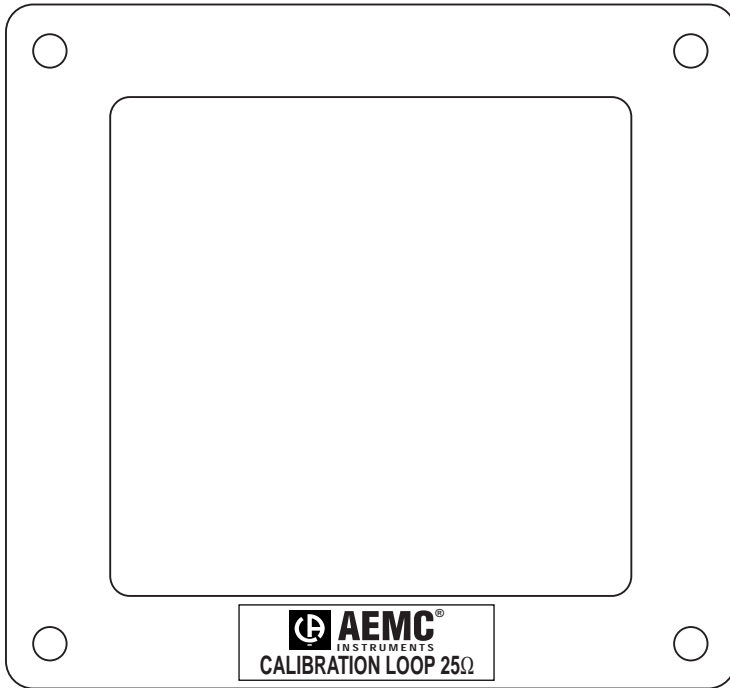

*Figure 33*

## Commonly Asked Questions for Clamp-on Ground Resistance Measurements

*Q. Can the Clamp-on method be used effectively on high tension towers despite the distance or spacing between them?*

A. Yes. Extended distances will not adversely effect the measurement results. The important factor is that it be a multiple electrode system.

*Q. Does the grounding electrode have to be disconnected and isolated as is required when using the "Fall-Of-Potential" test with auxiliary electrodes?*

A. No. Actually the electrode must be connected to the system to provide the path for test signal injection as well as to provide the background impedance necessary as the reference. Additionally, if the tested rod is poorly bonded to the ground connector, a high reading will be present.

*Q. Does this mean I am not able to test an independent electrode?*

A. No, however as soon as the connection is made to a multiple electrode system, usually provided by the connection to the system neutral, you can clamp on and make a measurement.

*Q. Must the instrument be clamped directly on the electrode?*

A. No, the instrument will provide valid measurement results when clamped on to the electrode or the conductor leading to the grounding electrode. The reading through the conductor will also verify not only the grounding electrode resistance, but connections of the ground wire to the rest of the system.

*Q. Does the system under test have to be energized or de-energized to perform the test?*

A We are measuring the grounding network. The only requirements are that ground connections be made to the system under test and that the voltage-to-ground at the tested point not exceed the instrument rating.

*Q. Can the clamp-on method be used for substation grid resistance testing?*

A. It depends. It can be used as long as the instrument can be clamped onto a point on the grounding system at a common point where it ties to the system neutral. Testing a grid must be treated as if it were a single electrode. Often, clamping on to points within the grid system will yield a closed loop reading.

*Q. How does clamp-on ground testing compare with the standard "Fall-Of-Potential" test?*

A. Empirical testing has validated that when performed correctly, both methods will provide accurate and repeatable readings for ground electrode resistance.

*Q. How large a conductor can the jaw accommodate?*

A. The inner diameter of the jaw is 1.25" and can accommodate cables up to 1000 MCM.

## **Battery Replacement Procedure**

The Clamp-On Ground Resistance Testers are powered by a single 9 volt battery. The battery replacement indicator will display continuously when battery replacement is required.

Recommended replacement type is Alkaline (IEC 6LF22, 6LR61 or NEDA 1604A). Ni-Cad batteries may also be used. To change the battery refer to figure 15, page 17 and follow this procedure.

1. The instrument must be OFF and disconnected from any conductor.
2. Place the meter face down and remove the two Phillips screws on the back of the instrument.
3. Remove back cover by pulling it down and away from the instrument.
4. Lift the battery away from the case and disconnect the battery.
5. Connect the new battery and position the leads so that they won't get pinched when the cover is replaced.

6. Replace the back cover noting that it slips beneath the hold down lip and fits securely into position.

7. Install and tighten screws.

Typical battery life is approximately 8 hours of use or about 1000 separate 30-second measurements.

## Troubleshooting

### Symptom

### Indication/Recommended Action

Instrument will not turn ON

Low Battery  
*Replacement required*

Continuous audible tone

Alarm setpoint tripped  
*Deactivate Alarm or  
Change Setpoint Trigger mode*

Display is erratic

Foreign matter in jaws  
*Clean jaw mating surfaces*

Function controls inoperative

Hold button on  
*Turn HOLD off*

Light pulsing audible beep

Normal operation  
*Battery power management feature*

## Repair and Calibration

To guarantee that your instrument complies with the factory specifications, we recommend that the Models 3710 & 3730 be submitted to our factory service center at one-year intervals for recalibration, or as required by other standards.

For instrument repair and/or calibration, please call our factory, toll-free, at **(800) 945-AEMC** (800-945-2362):

CHAUVIN ARNOUX, Inc.  
d.b.a. AEMC® Instruments  
15 Faraday Drive  
Dover, NH 03820 USA  
Tel: (800) 954-2362  
(603) 749-6434  
Fax: (603) 742-2346

(Or contact your authorized distributor.)

Estimates for repairs, normal recalibration, and calibration traceable to N.I.S.T. are available upon request. Overseas customers must receive written authorization before returning any instrument.

## Technical and Sales Assistance

If you are experiencing any technical problems, or require any assistance with the proper use or application of this instrument, please call our technical hotline:

CHAUVIN ARNOUX, Inc.  
d.b.a. AEMC® Instruments  
200 Foxborough Blvd.  
Foxborough, MA 02035 USA  
Tel: (800) 343-1391  
(508) 698-2115  
Fax: (508) 698-2118  
[www.aemc.com](http://www.aemc.com)

## Limited Warranty

These Ground Resistance Testers Models 3710 & 3730 are warranted to the owner for a period of 2 years from the date of original purchase against defects in manufacture. This limited warranty is given by AEMC® Instruments, not by the distributor from whom it was purchased. This warranty is void if the Ground Resistance Testers Models 3710 & 3730 have been tampered with, abused, or if the defect is related to ser-vice not performed by AEMC® Instruments.

*What AEMC® Instruments Will Do:* If a malfunction occurs within the 2 year period, you may return the Ground Resistance Testers Models 3710 & 3730 to us for repair or replacement free of charge, provided we have your REGISTRATION CARD on file. AEMC® Instruments will, at its option, repair or replace the faulty material.

Note: If a card is not on file, we will require a dated proof of purchase as well as your REGISTRATION CARD accompanied by the defective material.

*What You Must Do:* First obtain a return authorization by phone or by fax from AEMC® Instruments, then return the Ground Resistance Testers Models 3710 & 3730, indicating place and date of purchase, with a written explanation of the reason for return. Return material, postage pre-paid to:

Chauvin Arnoux, Inc.  
d.b.a. AEMC® Instruments  
Service Department  
15 Faraday Drive  
Dover, NH 03820 USA  
Tel: (800) 945-2362  
(603) 749-6434  
Fax: (603) 742-2346

Caution: To protect against in-transit loss, we recommend that you insure your returned material.

For full warranty coverage, please read the Warranty Card which is affixed to the Warranty Registration Card. Please keep the Warranty Card with your records.

# Clamp-On Ground Resistance Testers Models 3710 and 3730

USER MANUAL



Chauvin Amoux, Inc. d.b.a. AEMC® Instruments

99-MAN-100061 Rev 05 03/98