

# Megohmmeter Model 1015



## MEGOHMMETERS

Copyright© Chauvin Arnoux®, Inc. d.b.a. AEMC® Instruments. All rights reserved.

No part of this documentation may be reproduced in any form or by any means (including electronic storage and retrieval or translation into any other language) without prior agreement and written consent from Chauvin Arnoux®, Inc., as governed by United States and International copyright laws.

Chauvin Arnoux®, Inc. d.b.a. AEMC® Instruments  
15 Faraday Drive • Dover, NH 03820 USA  
Tel: (800) 945-2362 or (603) 749-6434 • Fax: (603) 742-2346

This documentation is provided "as is," without warranty of any kind, express, implied, or otherwise. Chauvin Arnoux®, Inc. has made every reasonable effort to ensure that this documentation is accurate; but does not warrant the accuracy or completeness of the text, graphics, or other information contained in this documentation. Chauvin Arnoux®, Inc. shall not be liable for any damages, special, indirect, incidental, or inconsequential; including (but not limited to) physical, emotional or monetary damages due to lost revenues or lost profits that may result from the use of this documentation, whether or not the user of the documentation has been advised of the possibility of such damages.

# Statement of Compliance

Chauvin Arnoux®, Inc. d.b.a. AEMC® Instruments certifies that this instrument has been calibrated using standards and instruments traceable to international standards.

We guarantee that at the time of shipping your instrument has met the instrument's published specifications.

**An NIST traceable certificate may be requested at the time of purchase, or obtained by returning the instrument to our repair and calibration facility, for a nominal charge.**

The recommended calibration interval for this instrument is 12 months and begins on the date of receipt by the customer. For recalibration, please use our calibration services. Refer to our repair and calibration section at [www.aemc.com/calibration](http://www.aemc.com/calibration).

**Serial #:** \_\_\_\_\_

**Catalog #:** 1403.01

**Model #:** 1015

Please fill in the appropriate date as indicated:

Date Received: \_\_\_\_\_

Date Calibration Due: \_\_\_\_\_



Chauvin Arnoux®, Inc.  
d.b.a AEMC® Instruments  
[www.aemc.com](http://www.aemc.com)

---

# TABLE OF CONTENTS

---

<b>1. INTRODUCTION .....</b>	<b>5</b>
1.1 PRECAUTIONS FOR USE .....	6
1.2 RECEIVING YOUR SHIPMENT.....	6
1.3 ORDERING INFORMATION .....	7
1.3.1 Accessories and Replacement Parts.....	7
<b>2. PRODUCT FEATURES .....</b>	<b>8</b>
2.1 DESCRIPTION .....	8
2.2 FEATURES .....	8
2.3 CONTROL FEATURES .....	9
<b>3. SPECIFICATIONS.....</b>	<b>10</b>
3.1 ELECTRICAL SPECIFICATIONS .....	10
3.2 GENERAL SPECIFICATIONS .....	11
3.3 SAFETY SPECIFICATIONS .....	11
<b>4. OPERATION.....</b>	<b>12</b>
4.1 SAFETY CHECK (VOLTAGE TEST).....	12
4.2 INSULATION RESISTANCE TESTING (MΩ RANGE).....	12
4.2.1 Test Voltage .....	12
4.2.2 Spot Testing.....	13
4.2.3 Ratio Testing.....	13
4.2.4 Tips For Successful Insulation Resistance Testing .....	14
4.2.5 Insulation Measurement - Connections.....	14
4.2.6 Insulation Resistance Measurements on Motors .....	17
4.3 CONTINUITY MEASUREMENTS .....	18
4.4 RESISTANCE MEASUREMENTS.....	19
<b>5. MAINTENANCE .....</b>	<b>20</b>
5.1 BATTERY TEST .....	20
5.1.1 Battery and Fuse Replacement.....	20
5.2 CLEANING .....	21
5.3 REPAIR AND CALIBRATION .....	22
5.4 TECHNICAL ASSISTANCE .....	22
5.5 LIMITED WARRANTY .....	23
5.5.1 Warranty Repairs .....	23

---







# 1. INTRODUCTION

---

Thank you for purchasing an AEMC® Instruments **Megohmmeter Model 1015**.

For the best results from your instrument and for your safety, you must read the enclosed operating instructions carefully and comply with the precautions for use. Only qualified and trained operators should use this product.

## Symbols and Definitions

	Signifies that the instrument is protected by double or reinforced insulation
	<b>CAUTION - Risk of Danger!</b> Indicates a <b>WARNING</b> . Whenever this symbol is present, the operator must refer to the user manual before operation
	Indicates a risk of electric shock. The voltage at the parts marked with this symbol may be dangerous
	Important information to acknowledge
	This product complies with the Low Voltage & Electromagnetic Compatibility European directives (73/23/CEE & 89/336/CEE)
	In the European Union, this product is subject to a separate collection system for recycling electrical and electronic components in accordance with directive WEEE 2002/96/EC

## Definition of Measurement Categories (CAT)

- CAT IV:** Corresponds to measurements performed at the primary electrical supply (< 1000 V).  
*Example: primary overcurrent protection devices, ripple control units, and meters.*
- CAT III:** Corresponds to measurements performed in the building installation at the distribution level.  
*Example: hardwired equipment in fixed installation and circuit breakers.*
- CAT II:** Corresponds to measurements performed on circuits directly connected to the electrical distribution system.  
*Example: measurements on household appliances and portable tools.*

## 1.1 PRECAUTIONS FOR USE

These safety warnings are provided to ensure the safety of personnel and proper operation of the instrument.

- Read this instruction manual completely and follow all the safety information before attempting to use or service this instrument.
- Safety is the responsibility of the operator!
- Tests are to be carried out only on dead circuits! Check for live circuits before making resistance measurements (safety check).
- Always make connections from the instrument to the circuit under test.
- These megohmmeters are sources of high voltage, as is the sample connected to them. All persons performing or assisting in the tests must follow all safety precautions to prevent electrical shock to themselves and to others.
- AEMC® Instruments considers the use of rubber gloves to be an excellent safety practice even if the equipment is properly operated and correctly grounded.
- When testing capacitance samples, make sure that they have been properly discharged and that they are safe to touch. Dielectric insulation samples should be short-circuited for at least five times the amount of time they were energized.
- Never open the back of the instrument while connected to any circuit or input.

## 1.2 RECEIVING YOUR SHIPMENT

Upon receiving your shipment, make sure that the contents are consistent with the packing list. Notify your distributor of any missing items. If the equipment appears to be damaged, file a claim immediately with the carrier and notify your distributor at once, giving a detailed description of any damage. Save the damaged packing container to substantiate your claim.

1.3 ORDERING INFORMATION

Megohmmeter Model 1015.....Cat. #1403.01

*Includes a carrying case, shockproof rubber housing, set of black and red leads, black test probe, red alligator clip, spare fuse (inside megohmmeter), (4) 1.5 V alkaline AA batteries (not installed), and a user manual.*

1.3.1 Accessories and Replacement Parts

Lead - set of 2, 5 ft silicone color-coded (red/black) with 4 mm straight/right banana plugs (rated 1000 V, CAT IV, UL) ..... Cat. #5000.94

Clip - Safety Alligator - black (1000 V CAT IV, 15 A, UL V2)..... Cat. #5000.99

Probe - black test probe (rated 1000 V CAT IV, 15 A,UL V2).... Cat. #5000.97

Carrying Case .....Cat. #2119.02

Fuses, set of 5, 1.6 A..... Cat. #2970.22

**Order Accessories and Replacement Parts Directly Online**  
Check our Storefront at [www.aemc.com/store](http://www.aemc.com/store) for availability

---

## 2. PRODUCT FEATURES

---

### 2.1 DESCRIPTION

The Megohmmeter Model 1015 is a True Megohmmeter® analog instrument with four easy-to-read scales.

The  $M\Omega$  scale is an easy-to-read log scale graduated from (0.1 to 1000)  $M\Omega$  (yellow background) at 500 V and 1000 V. The  $\Omega$  scale is linear with a range from (0 to 10)  $\Omega$  (white background).

To use the (0 to 1000)  $\Omega$  scale, take the reading on the (0 to 10)  $\Omega$  range and multiply the reading by 100. The AC voltage scale is linear with a range of (0 to 600)  $V_{AC}$  (white background). Continuity tests are done with a test current of 200 mA.

The colored battery scale has a range of green for a good battery and a range of red or lower for a defective battery.

A built-in battery tester is provided by simply pressing the yellow push button when the selector switch is in the OFF position.

Voltmeter (safety check) with a range of (0 to 600)  $V_{AC}$  is standard and works when the selector switch is in the 500 V position or the 1000 V position.

### 2.2 FEATURES

- Measures insulation at 1000 V
- (0 to 1000)  $\Omega$  resistance range
- Push button for battery check
- Designed for harsh environments: offshore, mining, heavy-duty field, industrial, commercial electrical and military use
- (0 to 10)  $\Omega^+$  and (0 to 10)  $\Omega^-$  continuity ranges
- Continuity 200 mA test current
- Small and lightweight
- Large, direct-reading, colored scale
- 600 V test voltage range (safety check)
- Yellow non-slip shockproof case
- True Megohmmeter®



## 2.3 CONTROL FEATURES

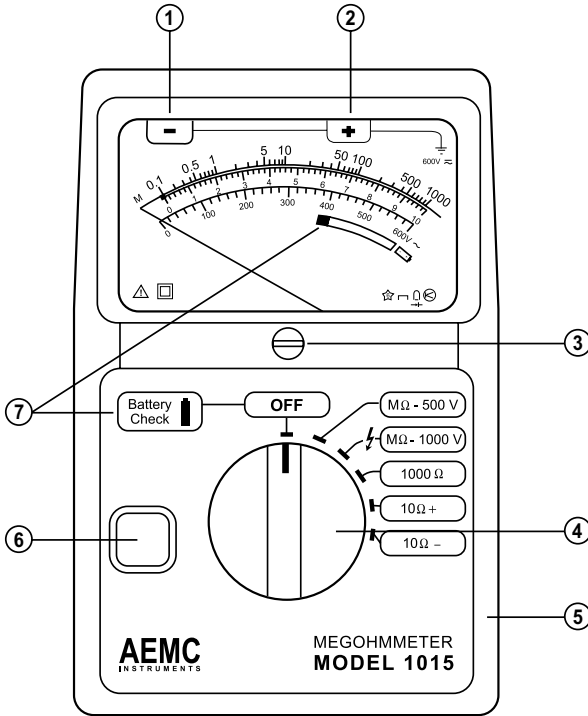


Figure 2

1. Line (-) terminal
2. Earth/Ground (+) terminal
3. Mechanical zero adjustment screws
4. 4-position rotary switch
5. Protective rubber housing
6. Push-to-test button
7. Battery check and indication display

---

## 3. SPECIFICATIONS

---

### 3.1 ELECTRICAL SPECIFICATIONS

#### INSULATION TESTS

**DC Test Voltage:** 500 V and 1000 V

**Megohm Range:** (0.1 to 1000) M $\Omega$

**Short Circuit Current:**  $\leq 6$  mA

**Accuracy:**  $\pm 5$  % of reading

**Discharging Time (Auto):** 1 s/ $\mu$ F

#### CONTINUITY TESTS

**Range:** (0 to 10)  $\Omega$ -; (0 to 10)  $\Omega$ +

**Short Circuit Current:**  $\geq 200$  mA

**Open Circuit Voltage:** (4.5 to 6.5) V

**Accuracy:**  $\pm 3$  % full scale

#### RESISTANCE TESTS

**Range:** (0 to 1000)  $\Omega$

**Short Circuit Current:**  $\geq 2$  mA

**Open Circuit Voltage:** (4.5 to 6.5) V

**Accuracy:**  $\pm 3$  % full scale

#### VOLTAGE TESTS (Safety Check)

**Voltage Range:** (0 to 600) V<sub>AC</sub>

**Frequency:** (45 to 400) Hz

**Accuracy:** 3 % of full scale

**Input Impedance:** 300 k $\Omega$

## 3.2 GENERAL SPECIFICATIONS

**Power Supply:** Four 1.5 V AA batteries

**Dielectric Test:** 6000 V, 50/60 Hz, 1 m

**Meter Movement:** Rugged taut band suspension

**Dimensions:** (6.6 x 4.2 x 2.2) in (167 x 106 x 55) mm

**Weight:** 1.45 lb (650 g)

**Operating Temperature Range:** (14 to 131) °F (-10 to 55) °C, (20 to 80) % RH

**Storage Range:** (-40 to 158) °F (-40 to 70) °C, (10 to 90) % RH

**Terminals:** “-” Line (black); “+” earth (red); accepts 4 mm banana plugs

*Reference Conditions: (63 to 73) °F (17 to 23) °C, (45 to 55) % RH; Supply Voltage: (5.3 to 5.7) V; Voltage Frequency: (45 to 65) Hz; Electric Field: < 1 V/M; Magnetic Field: < 40 A/M; Position: Horizontal ± 5°.*

## 3.3 SAFETY SPECIFICATIONS

**IEC 1010-1:** Safety requirements for electrical equipment for measurement, control and laboratory use

**VDE 0413-1:** Insulation testers

**VDE 0413-4:** Ohmmeters



**VDE 0100:** Specifications for the creation of high current installations of nominal voltage less than 1000 V

**IEC 801:** Electromagnetic compatibility for measurement and control equipment in industrial processes

Part 2: Sections relating to electrostatic discharges

Part 3: Sections relating to radiated electric fields

Part 4: Sections relating to electrostatic discharges

Part 5: Sections relating to electric shocks

**IEC 68.2.6:** Vibrations

**IEC 68.2.27:** Shocks

**IEC 68.2.29:** Shakes

**IEC 68.2.31:** Bumps

**IEC 68.2.32:** Free fall

**UL 94:** Self-extinguishing capability

*Specifications are subject to change at any time without notice*

---

## 4. OPERATION

---

### 4.1 SAFETY CHECK (VOLTAGE TEST)



**WARNING:** Make sure the jacks are firmly inserted into the top of the megohmmeter prior to performing any electrical tests.

---

Before measuring insulation resistance, confirm that the sample is fully discharged (particularly in dielectric and capacitance samples), and that the sample is not connected to an energized circuit.

#### To perform the voltage test:

- Set the range selection to  $M\Omega$  500 V or  $M\Omega$  1000 V
- Connect and read on the voltage scale (600 VAC max)

You do not need to press the yellow button to measure voltage.



**NOTE:** If measuring voltage on a DC circuit, the pointer will deflect but the measurement may be inaccurate.

---

### 4.2 INSULATION RESISTANCE TESTING ( $M\Omega$ RANGE)

After checking for a live circuit (see Safety Check above), connect the megohmmeter.

Several connection examples are illustrated in Figures 3 through 10.

#### 4.2.1 Test Voltage

No published standard tells which voltage to choose for any given winding. However, published recommendations could be summarized as follows:

Rated Voltage of Motor	Test Voltage
Below 115	250 V
115	250 V or 500 V
230	500 V
460	500 V or 1000 V

## 4.2.2 Spot Testing

As a general rule in spot testing, test voltage should be applied until no variation in reading is noted for 15 seconds, or applied for a fixed 60 seconds.

### What minimum value should be measured?

The IEEE standard No. 43-1974 states that it is impossible to specify the value of insulation resistance at which a winding will fail electrically, but on motors, minimum readings generally stated are:

Rated Voltage	R Minimum
250 or less	2 M $\Omega$
460	2 M $\Omega$

There is no fixed figure for determining what is good and bad in resistance readings, but a good guide would be 1 megohm for every one hundred applied operating volts, as a minimum figure. This applies to motors and transformers. When the insulation resistance gets this low, an electrical breakdown can be expected at any time, and rewinding or replacing should be considered.

It is not unusual for a winding to be 10 to 100 times the recommended minimum value (IEEE Std. #43-1974: *Recommended Practice for Testing Insulation Resistance of Rotating Machinery*), but this varies with temperature and humidity.

## 4.2.3 Ratio Testing

In time resistance reading (Dielectric Absorption Ratio), readings are taken at 30 seconds and 60 seconds to obtain the dielectric absorption ratio.

$$\frac{\text{Insulation resistance @ 60 s}}{\text{Insulation resistance @ 30 s}} = \text{Dielectric Absorption Ratio (DAR)}$$

This test is useful to increase the accuracy of spot testing. In general, a ratio of 1.25:2 or better should be required. A ratio below this indicates that repair is probably needed.

Remember, a DC insulation test may be used for acceptance testing, but is more commonly used to check the gradual deterioration of equipment over its life. Consult your equipment manufacturer for specific test or test voltage if not known.

Insulation resistance decreases with moisture, temperature and age and should be recorded over time at a given temperature and corrected.

## 4.2.4 Tips For Successful Insulation Resistance Testing

- Check with the equipment manufacturer for factory insulation resistance readings.
- Do not rely on insulation resistance testing alone as proof of winding conditions.
- Do not expect the same value for all parts of all machines.
- Observe consistent test time duration, recognizing that total current through insulation under test will vary with time.
- Correct all readings properly to a standard reference temperature (see IEEE Std. #43-1974, Temperature Correction Curve).
- Know what you are testing. Isolate the piece of equipment from other circuitry.
- Watch trends rather than relying on single spot readings.

## 4.2.5 Insulation Measurement - Connections

Figure 3 shows the connections to measure the insulation of one conductor to the other conductors. The cable should be disconnected at both ends to avoid leakage through switchboards and panels.

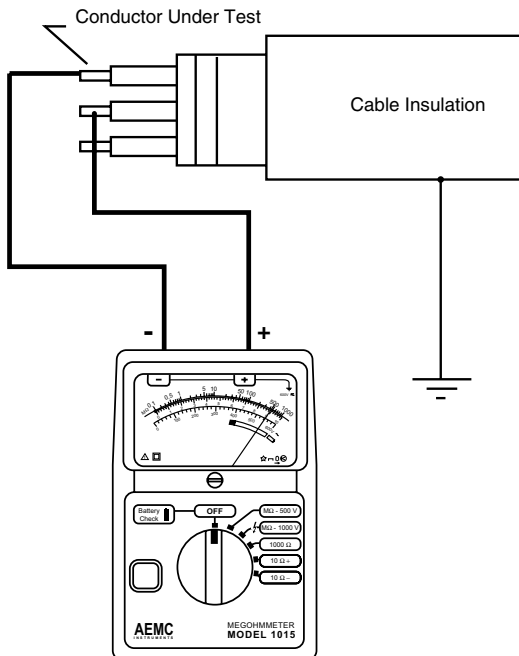


Figure 3

Figures 4 and 5 show the connections for testing insulation from a supply conductor to ground (motor frame).

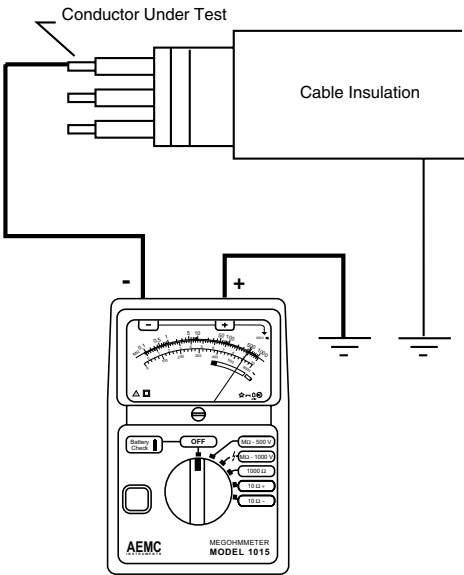


Figure 4

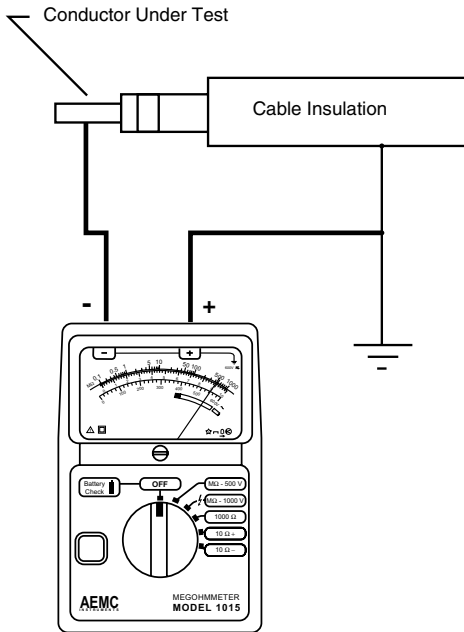


Figure 5

Figure 6 shows the connections to a transformer (lighting or distribution).

Make sure that the switches and/or circuit breakers on both sides are open.

Check the high voltage winding to ground, low voltage to ground, and the resistance between them with no winding grounded.

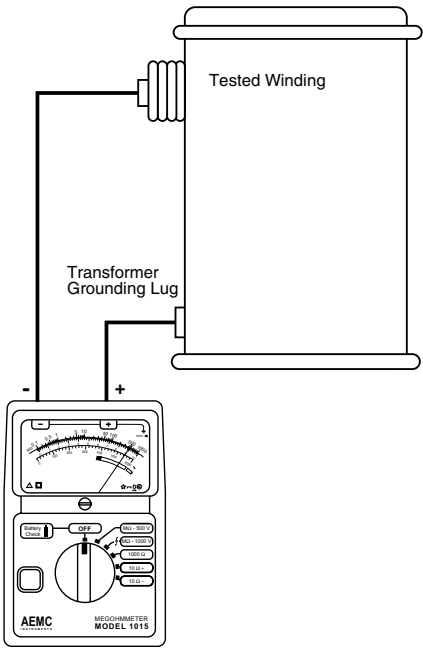


Figure 6

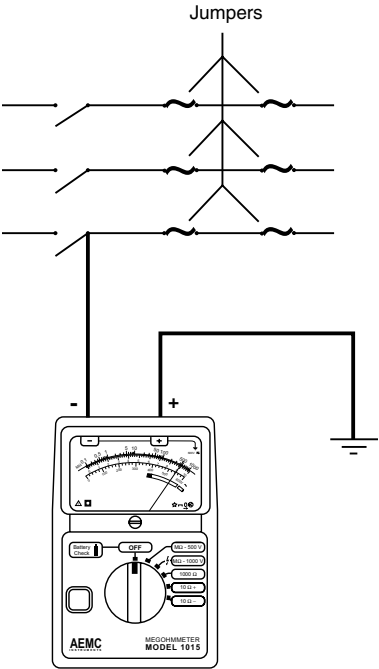


Figure 7

Figure 7 shows the connections for measuring the insulation of a three-phase line to ground by connecting the jumpers between phases.

This gives a reading of all conductors at once. If a load such as a motor, heater, etc., is attached to the other end of the line, it will read the load resistance to ground at the same time.

By removing the jumpers, readings can be made between the individual conductors and ground.



## 4.2.6 Insulation Resistance Measurements on Motors

Figure 8 shows reading the resistance to ground of a three-phase motor winding. Since the three-phase motors are internally connected, it is only necessary to connect one lead to the motor lead and the other lead to the motor frame as shown.

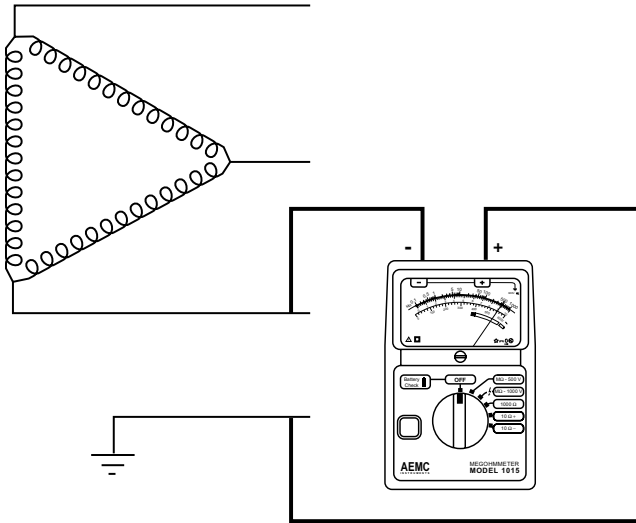


Figure 8

Figure 9 shows the windings of a three-phase motor separated.

Sometimes this can be done at the lead terminals, while other times the end bells must be removed to get at the lead wires of the coils.

By connecting the megohmmeter as shown, the phase insulation resistance value can now be determined.

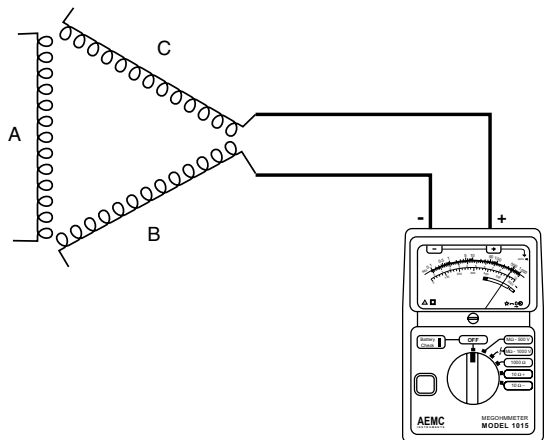


Figure 9

Read between phases "A" and "B", then "B" and "C", then "C" and "A".

Figure 10 shows connections for testing insulation from a supply conductor in a switchbox to ground (motor frame). An identical test may be carried out from the motor starter.

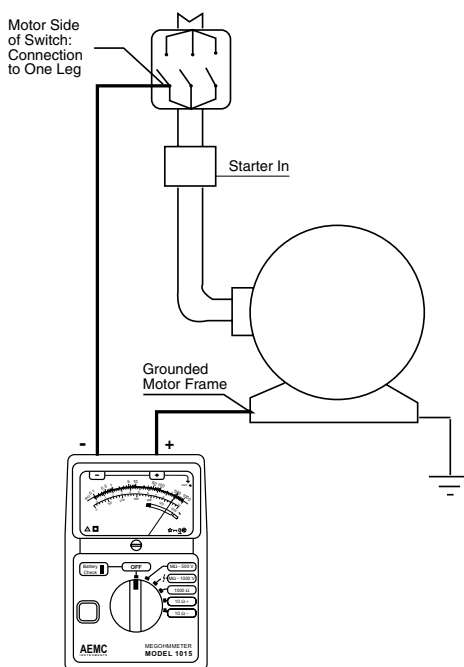


Figure 10

### 4.3 CONTINUITY MEASUREMENTS

Once it has been verified that no voltage is present, the continuity check may be performed.

- Set the switch to the 10  $\Omega$ + position. The measurement is done automatically; **you do not need to press the yellow button.**
- Read the value on the white scale (0 to 10)  $\Omega$ .
- Set the switch to the 10  $\Omega$ - position and make sure that the needle of the instrument reads the same value. If the second value is different from the preceding one, add up the two readings and divide by two. The reason for taking two different readings is to comply with the international standard VDE 0413-4. If your work does not require you to conform to this standard, only one measurement is necessary.
- Return to **OFF** after use.



**NOTE:** For better measurement accuracy on the 10  $\Omega$ + and the 10  $\Omega$ - ranges, measure the resistance of the leads by short-circuiting them, then subtract this value from the measured values.

## 4.4 RESISTANCE MEASUREMENTS

- Set the switch to the 1000  $\Omega$  position. The measurement is done automatically; **you do not need to press the yellow button.**
- Read the value on the white scale (0 to 10)  $\Omega$ , then multiply the reading by 100 to get the actual value measured.
- Return to **OFF** after use.

---

## 5. MAINTENANCE

---

The device does not contain any parts that can be replaced by untrained or unaccredited personnel. Any unauthorized work or part replacement with equivalents may seriously compromise safety.



### WARNING:

- For maintenance use only specified replacement parts.
- To avoid electrical shock, do not attempt to perform any servicing unless you are qualified to do so.
- To avoid electrical shock and/or damage to the instrument, do not get water or other foreign agents into the case. Turn the instrument **OFF** and disconnect the unit from all the circuits before opening the case.

### 5.1 BATTERY TEST

Check that the batteries are in good working condition prior to using the instrument.

**With the switch in the OFF position, press the yellow button:**

- The batteries are good if the needle is in the green zone.
- The batteries need replacement if the needle is in the red zone or lower.

**The average battery life is:**


- 1000 insulation measurements of 10 s on the  $M\Omega$  -500 V range for  $R = 500\text{ k}\Omega$ .
- 200 insulation measurements of 10 s on the  $M\Omega$  -1000 V range for  $R = 1\text{ M}\Omega$ .
- 1500 continuity measurements of 10 s on the  $10\text{ }\Omega$  range.



**NOTE:** The instrument will operate correctly with a battery voltage range of (4.5 to 6.5) V.

---

#### 5.1.1 Battery and Fuse Replacement

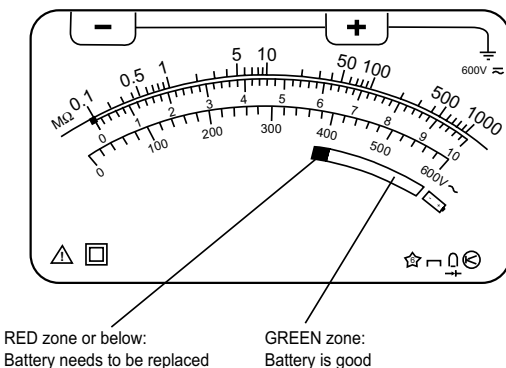



**WARNING:** Make sure that no terminals are connected and that the switch is in the **OFF** position before opening the back of the instrument.

- Remove the yellow shockproof housing.
- Remove the two screws from the back of the instrument (Figure 11).
- Remove the back cover.
- Replace the fuse or batteries.



**NOTE:** The instrument will operate correctly with a battery voltage range of (4.5 to 6.5) V.

- Reverse the above procedure to install the back cover and the shock proof housing.
- To close the back stand flush with the back cover, apply light pressure at Point A in Figure 11.

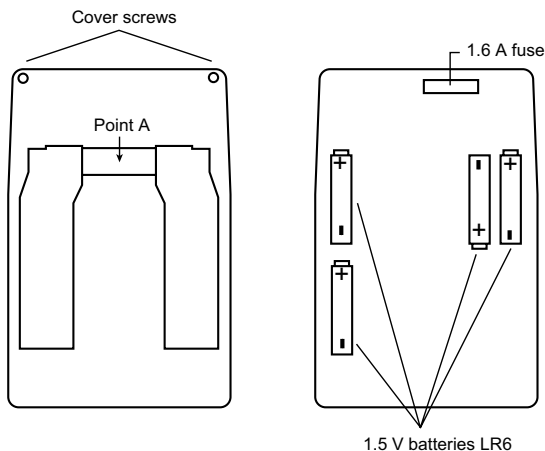


Figure 11

## 5.2 CLEANING



**WARNING:** Before cleaning, disconnect all inputs to prevent possible electric shock.

The instrument should be cleaned periodically to keep the LCD clear and prevent the buildup of dirt and grease around the instrument's buttons.

- Clean the body of the instrument with a damp and soapy cloth
- Do not submerge the instrument in water
- Do not use solvents

## 5.3 REPAIR AND CALIBRATION

To ensure that your instrument meets factory specifications, we recommend that it be sent back to our factory Service Center at one-year intervals for recalibration or as required by other standards or internal procedures.

### For instrument repair and calibration:

You must contact our Service Center for a Customer Service Authorization Number (CSA#). Send an email to [repair@aemc.com](mailto:repair@aemc.com) requesting a CSA#, you will be provided a CSA Form and other required paperwork along with the next steps to complete the request. Then return the instrument along with the signed CSA Form. This will ensure that when your instrument arrives, it will be tracked and processed promptly. Please write the CSA# on the outside of the shipping container. If the instrument is returned for calibration, we need to know if you want a standard calibration or a calibration traceable to N.I.S.T. (includes calibration certificate plus recorded calibration data).

**Ship To:** Chauvin Arnoux®, Inc. d.b.a. AEMC® Instruments  
15 Faraday Drive • Dover, NH 03820 USA  
Phone: (800) 945-2362 (Ext. 360) / (603) 749-6434 (Ext. 360)  
Fax: (603) 742-2346  
E-mail: [repair@aemc.com](mailto:repair@aemc.com)

### (Or contact your authorized distributor.)

Contact us for the costs for repair, standard calibration, and calibration traceable to N.I.S.T.



**NOTE:** You must obtain a CSA# before returning any instrument.

---

## 5.4 TECHNICAL ASSISTANCE

If you are experiencing any technical problems or require any assistance with the proper operation or application of your instrument, please call, e-mail or fax our technical support team:

Chauvin Arnoux®, Inc. d.b.a. AEMC® Instruments  
Phone: (800) 343-1391 (Ext. 351)  
Fax: (603) 742-2346  
E-mail: [techsupport@aemc.com](mailto:techsupport@aemc.com)  
[www.aemc.com](http://www.aemc.com)

## 5.5 LIMITED WARRANTY

The instrument is warranted to the owner for a period of two years from the date of original purchase against defects in manufacture. This limited warranty is given by AEMC® Instruments, not by the distributor from whom it was purchased. This warranty is void if the unit has been tampered with, abused, or if the defect is related to service not performed by AEMC® Instruments.

**Full warranty coverage and product registration is available on our website at [www.aemc.com/warranty.html](http://www.aemc.com/warranty.html)**

**Please print the online Warranty Coverage Information for your records.**

### **What AEMC® Instruments will do:**

If a malfunction occurs within the warranty period, you may return the instrument to us for repair, provided we have your warranty registration information on file or a proof of purchase. AEMC® Instruments will repair or replace the faulty material at our discretion.

**REGISTER ONLINE AT: [www.aemc.com/warranty.html](http://www.aemc.com/warranty.html)**

### **5.5.1 Warranty Repairs**

#### **What you must do to return an Instrument for Warranty Repair:**

First, send an email to [repair@aemc.com](mailto:repair@aemc.com) requesting a Customer Service Authorization Number (CSA#) from our Service Department. You will be provided a CSA Form and other required paperwork along with the next steps to complete the request. Then return the instrument along with the signed CSA Form. Please write the CSA# on the outside of the shipping container. Return the instrument, postage or shipment pre-paid to:

Chauvin Arnoux®, Inc. d.b.a. AEMC® Instruments  
15 Faraday Drive, Dover, NH 03820 USA  
Phone: (800) 945-2362 (Ext. 360) / (603) 749-6434 (Ext. 360)  
Fax: (603) 742-2346  
E-mail: [repair@aemc.com](mailto:repair@aemc.com)

**Caution: To protect yourself against in-transit loss, we recommend that you insure your returned material.**



**NOTE:** You must obtain a CSA# before returning any instrument.

---



08/23

99-MAN 100089 v17

---

**AEMC<sup>®</sup> Instruments**

15 Faraday Drive • Dover, NH 03820 USA

Phone: (603) 749-6434 • (800) 343-1391 • Fax: (603) 742-2346

**[www.aemc.com](http://www.aemc.com)**